

Work Order ID 84540

\*84540\*

Page 1

Item ID: D2580-1

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: 205 Skidtube bent detail

Start Date: 15/05/2012 Start Qty: 2.00

\*2\*

Cust Item ID:

Required Date: 17/05/2012 Req'd Qty: 2.00

\*2\*

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/05/16 Tooling:

Date:

Run Start \*NR1\*

QC:

Date: SPC (Y/N):

Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	---------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D2580

E

100

\*100\*

Skidtubes

Skidtubes

Memo

1- Inspect mat'l D2500-1-190 for damage.

2-Drill pilot holes using drill jig DT 8149 (Do not use cutting fluid)

3-Open holes to 0.500" as per Dwg D2580 without cutting fluid

4-Deburr holes per QSI002 section 4.2.3 and blow out all chips from inside of tube

5- Chemical Conversion Coat as per QSI 005 4.1

6-Bond web in place per QSI 015.

A/R Sikaflex-291 batch: 121221

Sikaflex expire date: 12/05/16

Start time and date: 8:00 AM bond for 12hrs

12-05-22

12-05-23

PTO

W/O: 84540		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D2580-1 PAR #: \_\_\_\_\_ Fault Category: aid tubes NCR: Yes No DQA: Not Date: 12/07/19  
 Resolution: \_\_\_\_\_ Disposition: Scrap QA: N/C Closed: OK Date: 12/7/20

NCR: 12-1606		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
12-5-22	100	Both Fwd + Aft Saddle tubes do not line up w/inspection jig.	12/07/19	Scrap + Destroy 2 tubes B#84540 NO replace.	12/07/19	12-7-17	12/07/19	DAS 16 2-89 12/07/19
		RC, employee error						

NOTE: Date & initial all entries

**\*84540\***

Page 2

**\*N900040100\***

Setup Start \*NS1\*

Stop \*NS2\*

**Start Date:** 15/05/2012      **Start Qty:** 2.00

\*?\*

**Cust Item ID:**

**Required Date:** 17/05/2012      **Req'd Qty:** 2.00

\*2\*

**Customer:**

**Reference:**

**Approvals:**      **Process Plan:** \_\_\_\_\_ **Date:** \_\_\_\_\_ **Tooling:** \_\_\_\_\_ **Date:** \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop ~~\*NR2\*~~

**Insp.  
Stamp**

QC6- Inspect dimensions to drawing

0.00

\*101\*

QC

## Memo

0.00

## Quality Control

130

### QC7-Inspect Chemical Conversion Coat

0.00

**\*130\***

OC

## Memo

0.00

## Quality Control

140

Identify as per dwg & Stock Location: ☒

0.00

**\*140\***

## Packaging

## Memo

0.00

## Packaging

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 84540****\*84540\***

Page 3

Item ID: D2580-1

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: 205 Skidtube bent detail

Start Date: 15/05/2012 Start Qty: 2.00

**\*2\***

Cust Item ID:

Required Date: 17/05/2012 Req'd Qty: 2.00

**\*2\***

Customer:

Reference:

Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Stop **\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

150

QC21- Final Inspection - Work Order Release

0.00

**\*150\***

QC

Memo

0.00

Quality Control

*MF*  
*12-07-18*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

May-16-12 7:52:31 AM

Page 1

Work Order ID: 84540

**\*84540\***

Parent Item: D2580-1

**\*D2580-1\***

Parent Item Name: 205 Skidtube bent detail

Start Date: 15/05/2012

Required Date: 17/05/2012

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM IPP Rev:C  
10.12.01 as per DEO D1 DD verf:ec

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured No

100

Each

95.0000

1

**\*D2500-1-190\***

Ext'n - 'I' Beam Tube 4"

\*\*

(2)

12-05-22

Location

Loc Qty

Loc Code

HALL

95

74777

16

8006

79

D2596

Manufactured No

100

Each

2.0000

1

**\*D2596\***

Web, 205 Skidtube

\*\*

(2)

12-05-23

B 82322

Location

Loc Qty

Loc Code

LG

2

80820

1

82323

1

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	PART NUMBER	DESCRIPTION
1	X			D2580-041	SKIDTUBE ASSEMBLY
2		X		D2580-045	SKIDTUBE ASSEMBLY
3			X	D2580-047	SKIDTUBE ASSEMBLY
4	1	1	1	D2500-1-190	EXTRUSION
5			16	D2570	BUSHING
6	1	1	1	D2576-3	STEP
7	20	24	25	D2579	SPACER
8	16	16	8	D2594-1	PLUG
9	16	16	8	D2594-3	O-RING
10	1	1	1	D2596	205 WEB
11	1	1	1	D2855	AFT CAP
12	1	1		D3564-5	WEARSHOE
13	1	1		D3564-9	WEARSHOE
14	1	1		D3564-11	WEARSHOE
15	1	1		D3564-13	WEARSHOE
16	2	2		D3566-1	GASKET
17	1	1		D3566-5	GASKET
18	1	1		D3566-13	GASKET
19			1	D4406-041	WEARPLATE ASSEMBLY
20			1	D4406-043	WEARPLATE ASSEMBLY
21	50	50		ALST-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
22	50	50		AN3C4A	BOLT
23	2	2	2	AN3-5A	BOLT
24			8	AN4-45A	BOLT
25	50	50		NAS1149C0332R	WASHER (AN960C10L)
26	2	2	2	NAS1149D0332J	WASHER (AN960JD10L)
27			8	MS21042-4	NUT (OR MS21042L4)

#### GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3  
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs  
D2580-045 = 34.5 lbs  
D2580-047 = 37.7 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALST-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

DEO ATTACHED

RELEASED

2011-08-29

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 89540 MLCJ  
12/05/16

E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	#	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 1 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	10	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

# Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

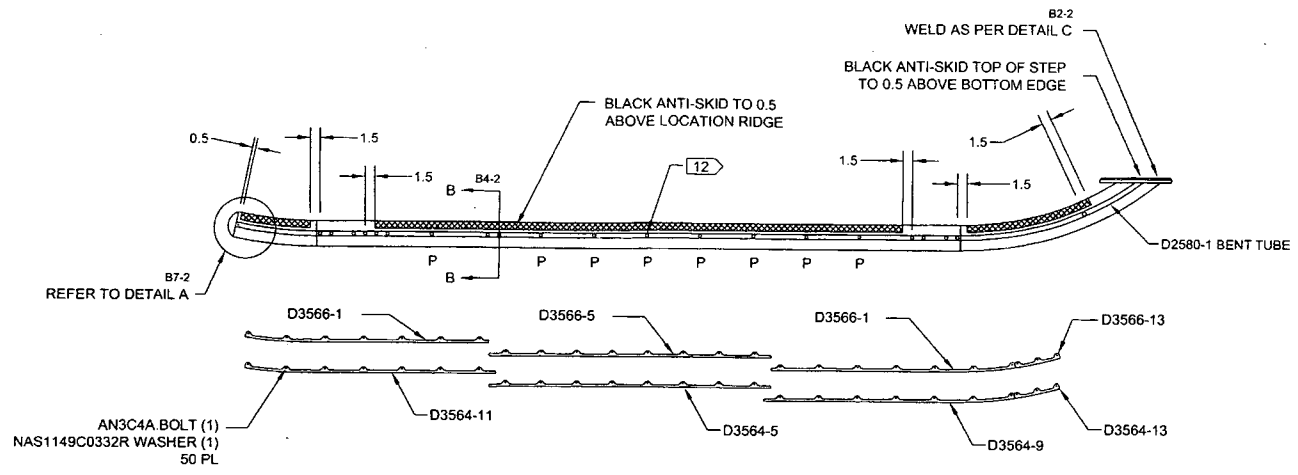


**D2580-041 ASSEMBLY DETAIL**

**DETAIL A**  
SCALE 5X  
C7-2

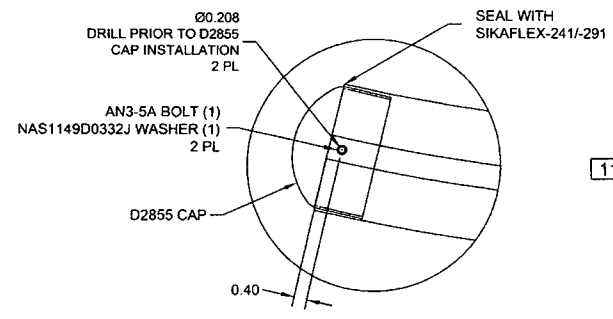


**SECTION B-B**  
SCALE 5X  
D5-2

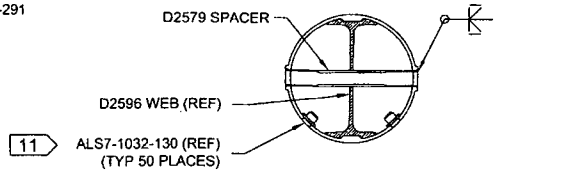

- AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D2579 SPACER (20 PLACES)
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C-BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

**DETAIL C**  
SCALE 5X  
D3-2

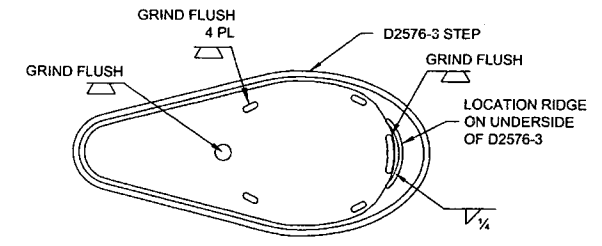

DESIGN	4	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	14	DRAWING NO.	REV. E
MFG. APPR.	14	D2580	SHEET 2 OF 8
APPROVED	14	TITLE	SCALE
DE APPR.	14	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	

84510

DEO ATTACHED  
RELEASED  
2011-08-29

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

24540

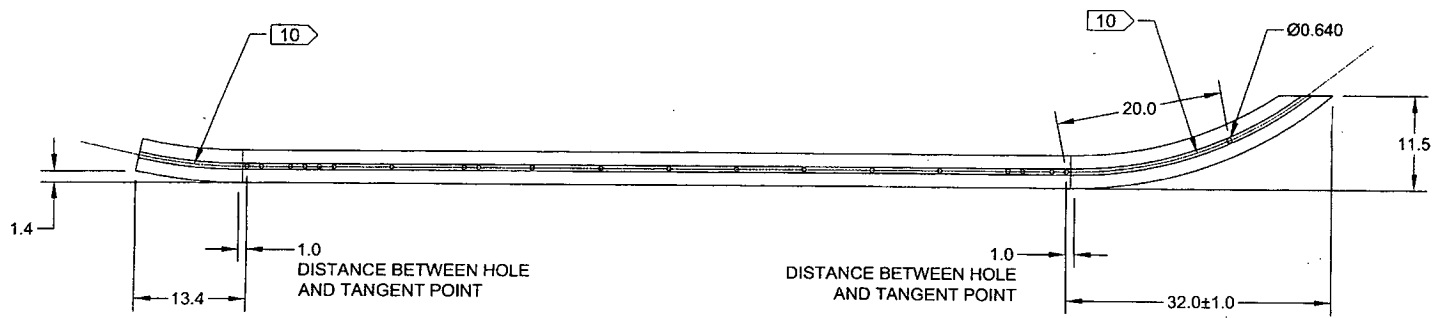

D2580-1 BENT TUBE  
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED

RELEASED  
2011-08-28  
JNY

DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	RF	D2580	SHEET 3 OF 8
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

**Dart Aerospace Ltd**



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

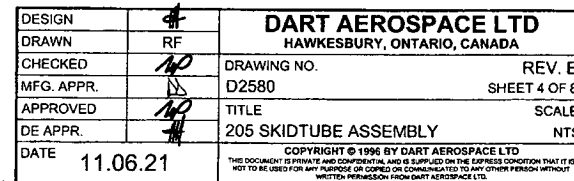

**Dart Aerospace Ltd**


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_  
 Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



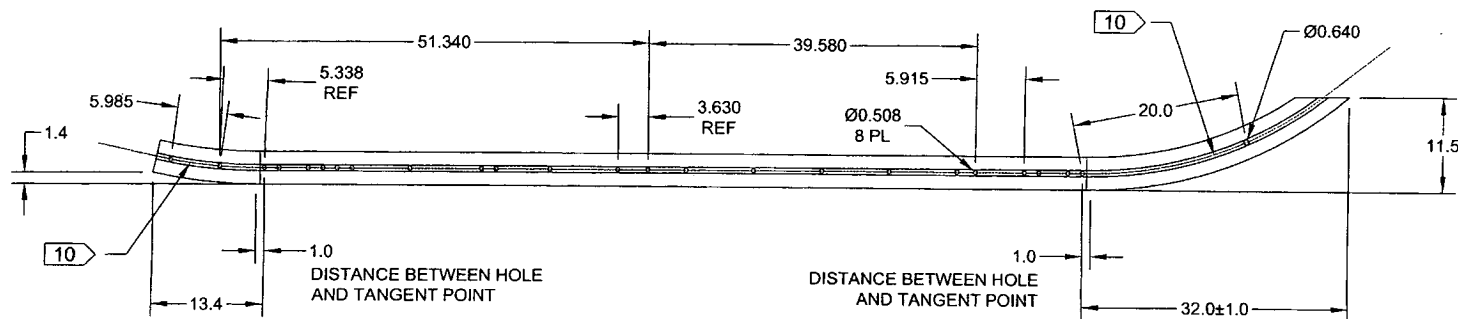

**D2580-5 BENT TUBE**  
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED

RELEASED  
2011-08-29

DESIGN	<i>[Signature]</i>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	



**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_  
 Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

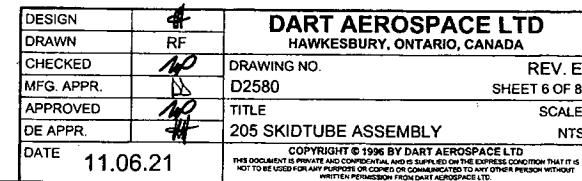

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

24540

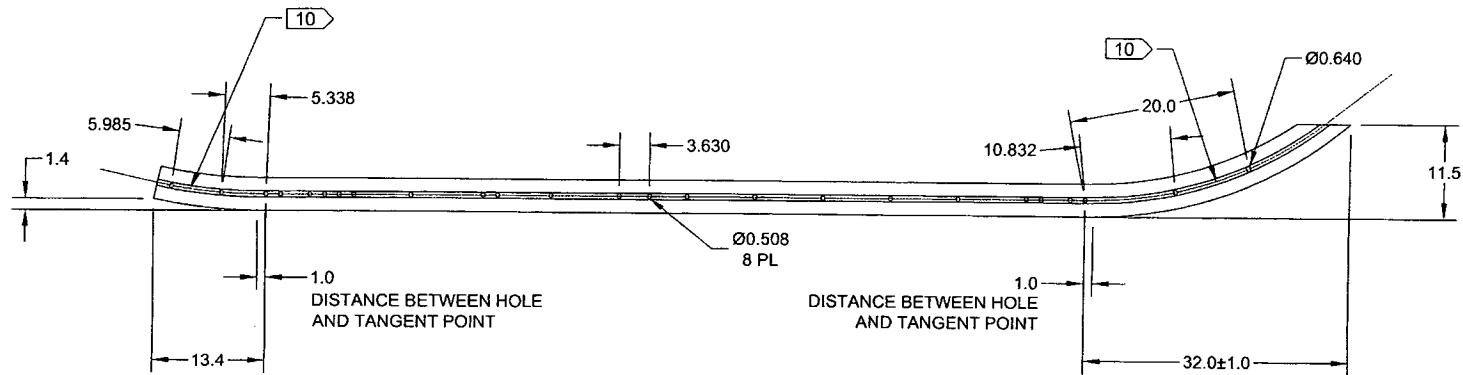

D2580-7 BENT TUBE  
(MAKE FROM D2580-101 TUBE)



DEO ATTACHED

RELEASED  
2011-08-29

DESIGN	#	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	RP	DRAWING NO.	REV. E
MFG. APPR.		D2580	SHEET 7 OF 8
APPROVED	RP	TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

04540

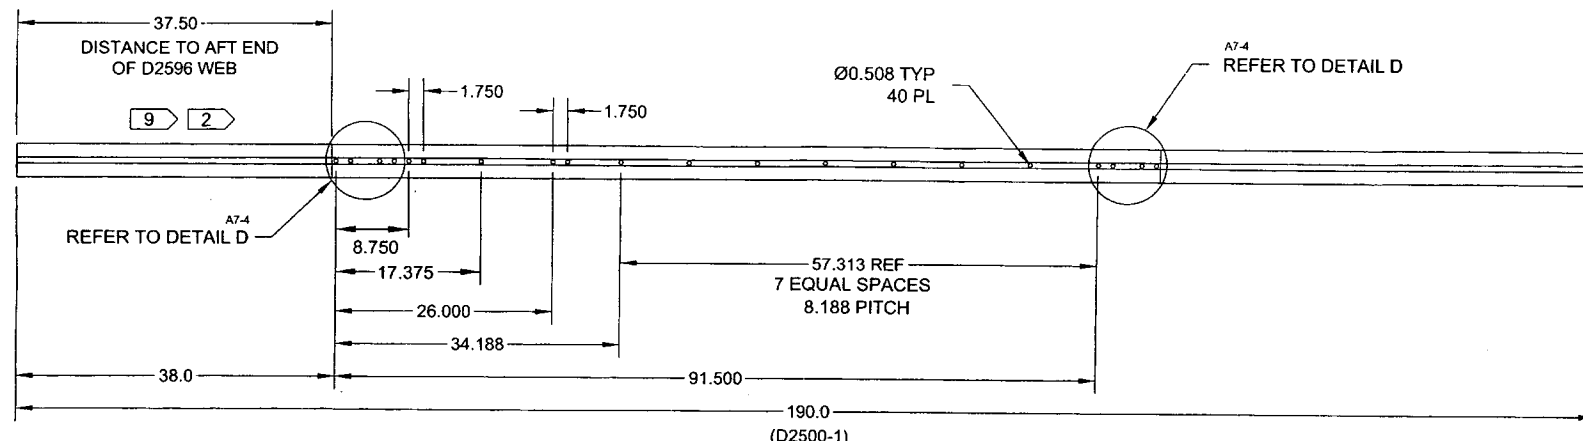

D2580-101 TUBE

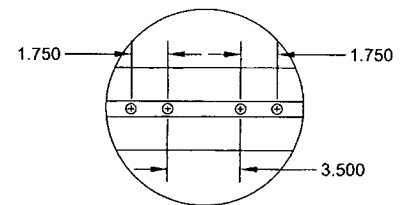

DETAIL D D3-4  
SCALE 5X C7-4

DEO ATTACHED  
**RELEASED**  
R 2011-08-29

DESIGN	#	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	AP	DRAWING NO.	REV. E
MFG. APPR.	AS	D2580	SHEET 8 OF 8
APPROVED	AP	TITLE	SCALE
DE APPR.	AS	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



DRAWING NO. D2580	TITLE 205 SKIDTUBE ASSEMBLY	REV. E	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>	D.E.O. NO. D2580-E-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>ER</i>	APPROVED <i>#</i>	DE APPR. <i>#</i>		
DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	DATE 11.12.13		

**PURPOSE:**

CHANGE ALL C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**WAS**

QTY	QTY	QTY	PART NUMBER	DESCRIPTION
-041	-045	-047		
20	24	25	D2579	CROSS BOLT SPACER


**IS**

	4		* D2579	CROSS BOLT SPACER
20	20	25	D4202-1	SPACER

SECTION B-B, SECTION F-F, & SECTION I-I ARE AMENDED AS FOLLOWS  
FOR ALL HOLES THAT WERE ORIGINALLY C'BORED:

**\* FOR -045 SKIDTUBE ONLY:**  
WELD 4X D2579 SPACERS PER DWG  
IN LOCATIONS MARKED "NO C'BORE".  
REF SHEET 4 OF DWG.

**RELEASED**  
2011-12-14 *MP*

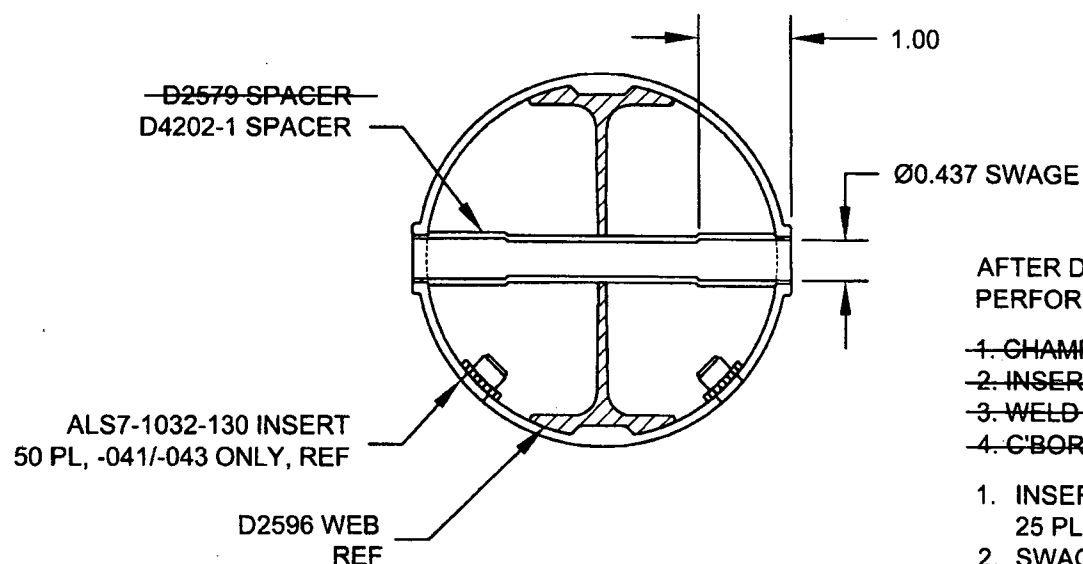

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

1. INSERT D4202-1 SPACER, 20 PL (-041) OR 20 PL (-045) OR 25 PL (-047)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

**SECTION B-B, F-F, I-I**  
NOT TO SCALE

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries